

Westbury Union Free School District

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

2020-2021



ENVIROSCIENCE
CONSULTANTS INC.

2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191
www.envirohealth.org

Project # 20467

**Districtwide Lead in Drinking Water
Sampling and Remediation Plan**

Performed for:

**Westbury Union Free School District
2 Hitchcock Lane
Old Westbury, NY 11568**

June 2021

Prepared by:

**Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779
(631) 580-3191**

Project #20467

President



Glenn Neuschwender

Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

I. Executive Summary

II. Sampling Methodology

III. Initial Results

Appendix A – Drexel Avenue School

Appendix B – Dryden Street School

Appendix C – Park Avenue School

Appendix D – Powells Lane School

Appendix E – Westbury Middle School

Appendix F – Westbury High School

June 11, 2021

Guy Forman
Westbury Union Free School District
2 Hitchcock Lane
Old Westbury, NY 11568

I. Executive Summary

The Westbury Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Westbury Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary classroom sinks
- 5) Home economics sinks
- 5) Bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Westbury Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks – this category often includes mixed valve outlets or staff bathrooms. In intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Procedures:

In accordance with the regulation, EnviroScience Consultants, Inc. performed initial water sampling throughout the Westbury Union Free School District on June 3 and 4, 2021. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler
 HB Hose Bib
 IM Ice Machine
 OS Other Source
 PF Pot Filler
 SK Sink
 SL Supply Line
 SP Spigot
 SPY Spray
 SS Slop Sink
 V Valve
 WC Water Cooler
 WF Water Fountain


Source Designations

App Applicable
 N/A Non-applicable

Remediation Type Codes

FR Fixture Replacement
 FRSLV Fixture, supply line or valve replacement
 FRSLVPA Fixture, supply line or valve replacement plumbing assessment
 SIGN Non-potable water sign posted
 CAPPED Supply line capped or fixture removed

Sampling Location Schematics

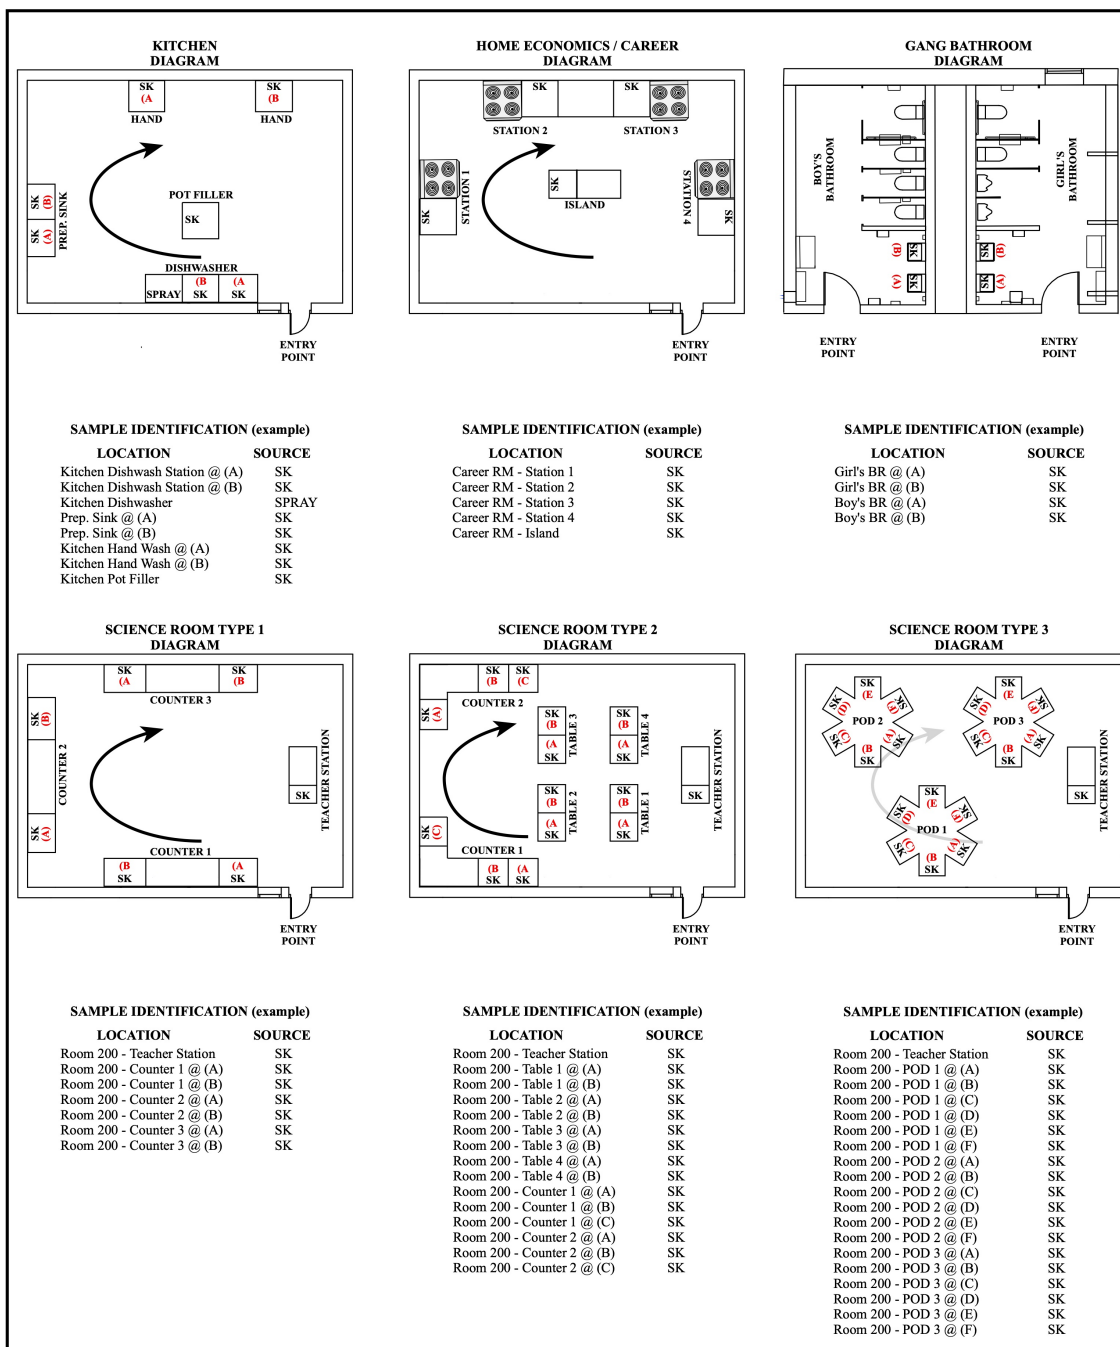

III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through D).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested before returning to service. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Drexel Avenue School

Storage Room 25	SK	93.9
Storage Room 25	WF	29.1
Room 18	WF	16

Dryden Street School

Room 3 Bathroom	SK	19.5
Room 5 Bathroom	SK	79.5

Park Avenue School

Room 1	WF	69.2
Portable R	WF	22.2

Powells Lane School

Room 18	SK	15.6
Room 8	SK	23.8
Room 2 Bathroom	SK	16
Room "F" Bathroom	SK	36.8

Westbury Middle School

Bathroom by Wood Shop	SK	145
Nurse's Office	SK	264
Nurse's Office Exam Room	SK	612
Room 100-Home Economics @A	SK	84
Room 100-Home Economics @B	SK	30.3
Boy's Bathroom in Auditorium-Right	SK	65.8
Room 307-Left	SK	28.1
Room 307-Right	SK	163

Westbury High School

Main Lobby Girl's Bathroom Left	SK	19.5
---------------------------------	----	------

Appendix A

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Basement Bathroom by Custodial Kitchenette	SK	App	3.05	6/4/2021	-	-	-	None	-	-	-
1001-01	Kitchen	IM	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-02	Kitchen 3-Bay Left	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-03	Kitchen 3-Bay Right	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-04	Kitchen Island	SK	App	1.35	6/4/2021	-	-	-	None	-	-	-
1002-01	Main Lobby Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1003-01	Principal's Office Kitchenette	SK	App	2.93	6/4/2021	-	-	-	None	-	-	-
1003-02	Principal's Office Kitchenette	SPY	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1004-01	Room 7 Bathroom	SK	App	1.02	6/4/2021	-	-	-	None	-	-	-
1005-01	Hall by Room 7	BF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1005-02	Hall by Room 7	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1006-01	Faculty Room	SK	App	3.43	6/4/2021	-	-	-	None	-	-	-
1007-01	Hall by Auditorium	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1008-01	Room 44 Custodial Storage	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1009-01	Room 45	SK	App	2.58	6/4/2021	-	-	-	None	-	-	-
1010-01	Room 26	SK	App	6.43	6/4/2021	-	-	-	None	-	-	-
1011-01	Men's Faculty Bathroom by Room 26	SK	N/A		6/4/2021	-	-	-	Sign Required	-	-	-
1012-01	Hall by Room 26	BF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1012-02	Hall by Room 26	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1013-01	Women's Faculty Bathroom by Room 26	SK	N/A		6/4/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1014-01	Boy's Bathroom by Room 28 Left	SK	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1014-02	Boy's Bathroom by Room 28 Left Middle	SK	App	1.27	6/4/2021	-	-	-	None	-	-	-
1014-03	Boy's Bathroom by Room 28 Right Middle	SK	App	1.79	6/4/2021	-	-	-	None	-	-	-
1014-04	Boy's Bathroom by Room 28 Right	SK	App	5.55	6/4/2021	-	-	-	None	-	-	-
1015-01	Girl's Bathroom by Room 28 Left	SK	App	4.09	6/4/2021	-	-	-	None	-	-	-
1015-02	Girl's Bathroom by Room 28 Left Middle	SK	App	1.62	6/4/2021	-	-	-	None	-	-	-
1015-03	Girl's Bathroom by Room 28 Right Middle	SK	App	2.38	6/4/2021	-	-	-	None	-	-	-
1015-04	Girl's Bathroom by Room 28 Right	SK	App	2.03	6/4/2021	-	-	-	None	-	-	-
1016-01	Room 28	SK	App	1.39	6/4/2021	-	-	-	None	-	-	-
1016-02	Room 28	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1017-01	Room 30	SK	App	2.29	6/4/2021	-	-	-	None	-	-	-
1017-02	Room 30	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1018-01	Room 32	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1018-02	Room 32	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1019-01	Room 34	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1019-02	Room 34	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1020-01	Room 36	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1020-02	Room 36	WF	App		6/4/2021	-	-	-	None	-	-	-
1021-01	Room 38	SK	App	2.46	6/4/2021	-	-	-	None	-	-	-
1021-02	Room 38	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-01	Room 39	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1022-02	Room 39	WF	App	1.33	6/4/2021	-	-	-	None	-	-	-
1023-01	Room 37	SK	App	1.64	6/4/2021	-	-	-	None	-	-	-
1024-01	Room 35	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1025-01	Room 33	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1026-01	Room 31	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1026-02	Room 31	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1027-01	Room 29	SK	App	1.29	6/4/2021	-	-	-	None	-	-	-
1027-02	Room 29	WF	App	5.21	6/4/2021	-	-	-	None	-	-	-
1028-01	Storage Room 25	SK	App	93.9	6/4/2021				Additional Sampling Required			
1028-02	Storage Room 25	WF	App	29.1	6/4/2021				Additional Sampling Required			
1029-01	Room 10 Bathroom	SK	App	1.08	6/4/2021	-	-	-	None	-	-	-
1029-02	Room 12	SK	App	3.7	6/4/2021	-	-	-	None	-	-	-
1029-03	Room 12	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1030-01	Room 14	SK	App	6.16	6/4/2021	-	-	-	None	-	-	-
1030-02	Room 14	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1031-01	Room 16	SK	App	10.1	6/4/2021	-	-	-	None	-	-	-
1031-02	Room 16	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1032-01	Room 18	SK	App	2.69	6/4/2021	-	-	-	None	-	-	-
1032-02	Room 18	WF	App	16	6/4/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1034-01	Room 22	SK	App	2.69	6/4/2021	-	-	-	None	-	-	-
1035-01	Room 24	SK	App	4.57	6/4/2021	-	-	-	None	-	-	-
1036-01	Room 23	SK	App	2.07	6/4/2021	-	-	-	None	-	-	-
1037-01	Room 21	SK	App	2.54	6/4/2021	-	-	-	None	-	-	-
1038-01	Room 17	SK	App	7.28	6/4/2021	-	-	-	None	-	-	-
1038-02	Room 17	WF	App	2.47	6/4/2021	-	-	-	None	-	-	-
1039-01	Room 15	SK	App	4.05	6/4/2021	-	-	-	None	-	-	-
1039-02	Room 15	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1040-01	Room 13 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1041-01	Room 11	SK	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1041-02	Room 11 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1042-01	Girl's Bathroom by Room 10 Left	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1042-02	Girl's Bathroom by Room 10 Right	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1043-01	Custodial Closet by Room 10	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1044-01	Boy's Bathroom by Room 10 Left	SK	App	1.62	6/4/2021	-	-	-	None	-	-	-
1044-02	Boy's Bathroom by Room 10 Middle	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1044-03	Boy's Bathroom by Room 10 Right	SK	App	1.39	6/4/2021	-	-	-	None	-	-	-
1045-01	Nurse's Office Bathroom	SK	App	1.29	6/4/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212607-18114

June 8, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Drexel Ave School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 04, 2021. New York Environmental analyzed the samples on June 07, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P132	1	Kitchen-IM; Initial	1.00	<1.00	µg/L	
210604P133	2	Kitchen 3-Bay Left-SK; Initial	1.00	<1.00	µg/L	
210604P134	3	Kitchen 3-Bay Right-SK; Initial	1.00	<1.00	µg/L	
210604P135	4	Kitchen Island-SK; Initial	1.00	1.35	µg/L	
210604P136	5	Main Lobby Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P137	6	Principal's Office Kitchenette-SK; Initial	1.00	2.93	µg/L	
210604P138	7	Room 7 Bathroom-SK; Initial	1.00	1.02	µg/L	
210604P139	8	Hall by Room 7-BF; Initial	1.00	<1.00	µg/L	
210604P140	9	Faculty Room-SK; Initial	1.00	3.43	µg/L	
210604P141	10	Room 45-SK; Initial	1.00	2.58	µg/L	
210604P142	11	Room 26-SK; Initial	1.00	6.43	µg/L	
210604P143	12	Hall by Room 26-BF; Initial	1.00	<1.00	µg/L	
210604P144	13	Boy's Bathroom by Room 28 Left Middle-SK; Initial	1.00	1.27	µg/L	
210604P145	14	Boy's Bathroom by Room 28 Right Middle-SK; Initial	1.00	1.79	µg/L	
210604P146	15	Boy's Bathroom by Room 28 Right-SK; Initial	1.00	5.55	µg/L	
210604P147	16	Girl's Bathroom by Room 28 Left-SK; Initial	1.00	4.09	µg/L	
210604P148	17	Girl's Bathroom by Room 28 Left Middle-SK; Initial	1.00	1.62	µg/L	
210604P149	18	Girl's Bathroom by Room 28 Right Middle-SK; Initial	1.00	2.38	µg/L	
210604P150	19	Girl's Bathroom by Room 28 Right-SK; Initial	1.00	2.03	µg/L	
210604P151	20	Room 28-SK; Initial	1.00	1.39	µg/L	
210604P152	21	Room 30-SK; Initial	1.00	2.29	µg/L	
210604P153	22	Room 32-SK; Initial	1.00	<1.00	µg/L	
210604P154	23	Room 34-SK; Initial	1.00	<1.00	µg/L	
210604P155	24	Room 36-WF; Initial	1.00	<1.00	µg/L	
210604P156	25	Room 36-SK; Initial	1.00	<1.00	µg/L	
210604P157	26	Room 38-SK; Initial	1.00	2.46	µg/L	



Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P158	27	Room 39-WF; Initial	1.00	<1.00	µg/L	
210604P159	28	Room 39-SK; Initial	1.00	1.33	µg/L	
210604P160	29	Room 37-SK; Initial	1.00	1.64	µg/L	
210604P161	30	Room 35-SK; Initial	1.00	<1.00	µg/L	
210604P162	31	Room 33-SK; Initial	1.00	<1.00	µg/L	
210604P163	32	Room 31-SK; Initial	1.00	<1.00	µg/L	
210604P164	33	Room 29-SK; Initial	1.00	1.29	µg/L	
210604P165	34	Room 29-WF; Initial	1.00	5.21	µg/L	
210604P166	35	Storage Room 25-SK; Initial	1.00	93.9	µg/L	E,H
210604P167	36	Storage Room 25-WF; Initial	1.00	29.1	µg/L	H
210604P168	37	Room 10 Bathroom-SK; Initial	1.00	1.08	µg/L	
210604P169	38	Room 12-SK; Initial	1.00	3.70	µg/L	
210604P170	39	Room 14-SK; Initial	1.00	6.16	µg/L	
210604P171	40	Room 16-SK; Initial	1.00	10.1	µg/L	
210604P172	41	Room 18-WF; Initial	1.00	16.0	µg/L	H
210604P173	42	Room 18-SK; Initial	1.00	2.69	µg/L	
210604P174	43	Room 22-SK; Initial	1.00	3.87	µg/L	
210604P175	44	Room 24-SK; Initial	1.00	4.57	µg/L	
210604P176	45	Room 23-SK; Initial	1.00	2.07	µg/L	
210604P177	46	Room 21-SK; Initial	1.00	2.54	µg/L	
210604P178	47	Room 17-WF; Initial	1.00	2.47	µg/L	
210604P179	48	Room 17-SK; Initial	1.00	7.28	µg/L	
210604P180	49	Room 15-SK; Initial	1.00	4.05	µg/L	
210604P181	50	Room 13 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P182	51	Room 11 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P183	52	Girl's Bathroom by Room 10 Left-SK; Initial	1.00	<1.00	µg/L	
210604P184	53	Girl's Bathroom by Room 10 Right-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P185	54	Boy's Bathroom by Room 10 Left-SK; Initial	1.00	1.62	µg/L	
210604P186	55	Boy's Bathroom by Room 10 Middle-SK; Initial	1.00	<1.00	µg/L	
210604P187	56	Boy's Bathroom by Room 10 Right-SK; Initial	1.00	1.39	µg/L	
210604P188	57	Basement Bathroom by Custodial Kitchenette-SK; Initial	1.00	3.05	µg/L	
210604P189	58	Nurse's Office Bathroom-SK; Initial	1.00	1.29	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 2 Bay (Left)	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-2	Kitchen 2 Bay (Right)	SK	App	2.36	6/4/2021	-	-	-	None	-	-	-
1002-1	Faculty Bathroom by Main Entrance	SK	N/A		6/4/2021	-	-	-	Signed Required		-	-
1003-1	Custodial Closet by Main Entrance	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1004-1	Principals Office Kitchenette	SK	App	13.2	6/4/2021	-	-	-	None	-	-	-
1005-1	Student Unisex Bathroom by Kitchen	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1006-1	Nurses Office	SK	App	1.9	6/4/2021	-	-	-	None	-	-	-
1006-2	Nurses Office	SPY	App	1.56	6/4/2021	-	-	-	None	-	-	-
1006-3	Nurses Office Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1007-1	Registration Office	SK	App	2.05	6/4/2021	-	-	-	None	-	-	-
1007-2	Registration Office Bathroom	SK	N/A		6/4/2021	-	-	-	Signed Required	-	-	-
1008-1	Room 1	SK	App	3.92	6/4/2021	-	-	-	None	-	-	-
1008-2	Room 1 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1009-1	Room 3	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1009-2	Room 3	SK	App	1.79	6/4/2021	-	-	-	None	-	-	-
1009-3	Room 3 Bathroom	SK	App	19.5	6/4/2021				Additional Sampling Required			
1010-1	Room 2	SK	App	2.35	6/4/2021	-	-	-	None	-	-	-
1010-2	Room 2 Bathroom	SK	App		6/4/2021	-	-	-	None	Removed from service	-	-
1011-1	Room 5	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1011-2	Room 5 Bathroom	SK	App	79.5	6/4/2021				Additional Sampling Required			

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Hall by Room 4	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1012-2	Hall by Room 4 Bathroom	BF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1013-1	Room 4	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1013-2	Room 4	SK	App	1.78	6/4/2021	-	-	-	None	-	-	-
1013-3	Room 4 Bathroom	SK	App		6/4/2021	-	-	-	None	Removed from service	-	-
1014-1	Room 7	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1014-2	Room 7 Bathroom	SK	App	2.99	6/4/2021	-	-	-	None	-	-	-
1015-1	Room 9	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1015-2	Room 9	SK	App	1.1	6/4/2021	-	-	-	None	-	-	-
1016-1	Faculty Bathroom by Room 13	SK	N/A		6/4/2021	-	-	-	Signed Required	-	-	-
1017-1	Custodial Office by Room 13	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1018-1	Hall by Room 13	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1019-1	Student Unisex Bathroom by Room 13	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1020-1	Room 13	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1020-2	Room 13	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1020-3	Room 13 Bathroom	SK	App	8.99	6/4/2021	-	-	-	None	-	-	-
1021-1	Room 10	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1022-1	Room 12	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1023-1	Room 15	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1023-2	Room 15	SK	App	2.41	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1 st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-3	Room 15 Bathroom	SK	App	1.13	6/4/2021	-	-	-	None	-	-	-
1024-1	Room 14	SK	App	1.58	6/4/2021	-	-	-	None	-	-	-
1025-1	Room 6	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1025-2	Room 6	SK	App	6.66	6/4/2021	-	-	-	None	-	-	-
1026-1	Room 11	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1026-2	Room 11	SK	App	1.9	6/4/2021	-	-	-	None	-	-	-
1027-1	Hall by Room 6	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1028-1	Room 8	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1028-2	Room 8	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1029-1	Room "D" Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1030-1	Room "E" Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1031-1	Room "F" Bathroom	SK	App	1.4	6/4/2021	-	-	-	None	-	-	-
1032-1	Room "G" Bathroom	SK	App	1.2	6/4/2021	-	-	-	None	-	-	-
1033-1	Room "C" Bathroom	SK	App	1.09	6/4/2021	-	-	-	None	-	-	-
1034-1	Room "B" Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1035-1	Room "A" Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
0001-1	Basement Boiler Room	SS	N/A		6/4/2021	-	-	-	Signed Required	-	-	-
0002-1	Basement Custodial Office Bathroom	SK	N/A		6/4/2021	-	-	-	Signed Required	-	-	-
0003-1	Basement Book Room	SK	N/A		6/4/2021	-	-	-	Signed Required	-	-	-

Laboratory Report

NYE Report #: 2212608-18115

June 8, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Dryden Street Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 04, 2021. New York Environmental analyzed the samples on June 07, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P190	1	Kitchen 2 Bay (Left)-SK; Initial	1.00	<1.00	µg/L	
210604P191	2	Kitchen 2 Bay (Right)-SK; Initial	1.00	2.36	µg/L	
210604P192	3	Principals Office Kitchenette-SK; Initial	1.00	13.2	µg/L	
210604P193	4	Student Unisex Bathroom by Kitchen-SK; Initial	1.00	<1.00	µg/L	
210604P194	5	Nurses Office-SK; Initial	1.00	1.90	µg/L	
210604P195	6	Nurses Office-SPY; Initial	1.00	1.56	µg/L	
210604P196	7	Nurses Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P197	8	Registration Office-SK; Initial	1.00	2.05	µg/L	
210604P198	9	Room 1-SK; Initial	1.00	3.92	µg/L	
210604P199	10	Room 1 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P200	11	Room 3-SK; Initial	1.00	1.79	µg/L	
210604P201	12	Room 3 Bathroom-SK; Initial	1.00	19.5	µg/L	H
210604P202	13	Room 2-SK; Initial	1.00	2.35	µg/L	
210604P203	14	Room 5 -SK; Initial	1.00	<1.00	µg/L	
210604P204	15	Room 5 Bathroom-SK; Initial	1.00	79.5	µg/L	E,H
210604P205	16	Hall by Room 4 Bathroom-BF; Initial	1.00	<1.00	µg/L	
210604P206	17	Room 4 -SK; Initial	1.00	1.78	µg/L	
210604P207	18	Room 7-SK; Initial	1.00	<1.00	µg/L	
210604P208	19	Room 7 Bathroom-SK; Initial	1.00	2.99	µg/L	
210604P209	20	Room 9-SK; Initial	1.00	1.10	µg/L	
210604P210	21	Student Unisex Bathroom by Room 13-SK; Initial	1.00	<1.00	µg/L	
210604P211	22	Room 13-SK; Initial	1.00	<1.00	µg/L	
210604P212	23	Room 13 Bathroom-SK; Initial	1.00	8.99	µg/L	
210604P213	24	Room 10-SK; Initial	1.00	<1.00	µg/L	
210604P214	25	Room 12-SK; Initial	1.00	<1.00	µg/L	
210604P215	26	Room 15-SK; Initial	1.00	2.41	µg/L	

Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P216	27	Room 15 Bathroom-SK; Initial	1.00	1.13	µg/L	
210604P217	28	Room 14-SK; Initial	1.00	1.58	µg/L	
210604P218	29	Room 6-SK; Initial	1.00	6.66	µg/L	
210604P219	30	Room 11-SK; Initial	1.00	1.90	µg/L	
210604P220	31	Room 8-SK; Initial	1.00	<1.00	µg/L	
210604P221	32	Room "D" Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P222	33	Room "E" Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P223	34	Room "F" Bathroom-SK; Initial	1.00	1.40	µg/L	
210604P224	35	Room "G" Bathroom-SK; Initial	1.00	1.20	µg/L	
210604P225	36	Room "C" Bathroom-SK; Initial	1.00	1.09	µg/L	
210604P226	37	Room "B" Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P227	38	Room "A" Bathroom-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 2-Bay Unit	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-2	Kitchen Serving Area Prep Island	SK	App	1	6/4/2021	-	-	-	None	-	-	-
1001-3	Kitchen 3-Bay Unit Left	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-4	Kitchen 3-Bay Unit Middle	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-5	Kitchen 3-Bay Unit Right	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-6	Kitchen Handwash	SK	App	1.05	6/4/2021	-	-	-	None	-	-	-
1001-7	Kitchen Ice Machine	IM	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1001-8	Kitchen Custodial Closet	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1002-1	Room L Band Room Bathroom	SK	App	1.4	6/4/2021	-	-	-	None	-	-	-
1003-1	Room 35	SK	App	1.09	6/4/2021	-	-	-	None	-	-	-
1003-2	Room 35	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1004-1	Room 33	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1004-2	Room 33	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1005-1	Room 32	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1005-2	Room 32	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1006-1	Room 31	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1006-2	Room 31	WF	App	1.45	6/4/2021	-	-	-	None	-	-	-
1007-1	Room 30	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1007-2	Room 30	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1008-1	Room 29	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1008-2	Room 29	WF	App	1.36	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-1	Room 28	SK	App	2.48	6/4/2021	-	-	-	None	-	-	-
1009-2	Room 28	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1010-1	Room 27	SK	App	3.12	6/4/2021	-	-	-	None	-	-	-
1010-2	Room 27	WF	App	1.05	6/4/2021	-	-	-	None	-	-	-
1011-1	Room 26	SK	App	2.08	6/4/2021	-	-	-	None	-	-	-
1011-2	Room 26	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1012-1	Room 25	SK	App	2.28	6/4/2021	-	-	-	None	-	-	-
1012-2	Room 25	WF	App	7.76	6/4/2021	-	-	-	None	-	-	-
1013-1	Room 24	SK	App	3.49	6/4/2021	-	-	-	None	-	-	-
1013-2	Room 24	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1014-1	Room 23	SK	App	1.26	6/4/2021	-	-	-	None	-	-	-
1014-2	Room 23	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1015-1	Girl's Bathroom by Room 23 Left	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1015-2	Girl's Bathroom by Room 23 Left Middle	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1015-3	Girl's Bathroom by Room 23 Right Middle	SK	App	3.46	6/4/2021	-	-	-	None	-	-	-
1015-4	Girl's Bathroom by Room 23 Right	SK	App	1.79	6/4/2021	-	-	-	None	-	-	-
1016-1	Custodial Closet by Room 23	SS	N/A		6/4/2021	-	-	-	None	Locked Door	-	-
1017-1	Boy's Bathroom by Room 23 Left	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1017-2	Boy's Bathroom by Room 23 Left Middle	SK	App	1.09	6/4/2021	-	-	-	None	-	-	-
1017-3	Boy's Bathroom by Room 23 Middle	SK	App	1.31	6/4/2021	-	-	-	None	-	-	-
1017-4	Boy's Bathroom by Room 23 Right Middle	SK	App	1.23	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-5	Boy's Bathroom by Room 23 Right	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1018-1	Room 20	SK	App		6/4/2021	-	-	-	None	Removed from service	-	-
1018-2	Room 20	WF	App		6/4/2021	-	-	-	None	Removed from service	-	-
1018-3	Room 20 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1019-1	Room 21	SK	App	4.53	6/4/2021	-	-	-	None	-	-	-
1019-2	Room 21	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1019-3	Room 21 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1020-1	Room 22	SK	App	1.76	6/4/2021	-	-	-	None	-	-	-
1020-2	Room 22	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1020-3	Room 22 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1021-1	Room 19	SK	App	1.44	6/4/2021	-	-	-	None	-	-	-
1021-2	Room 19	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1021-3	Room 19 Bathroom	SK	App		6/4/2021	-	-	-	None	Removed from service	-	-
1022-1	Room 18	SK	App	3.61	6/4/2021	-	-	-	None	-	-	-
1022-2	Room 18	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1022-3	Room 18 Bathroom	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1023-1	Room 17	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1023-2	Room 17	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1024-1	Room 16	SK	App	1.49	6/4/2021	-	-	-	None	-	-	-
1024-2	Room 16	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1025-1	Room 15	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-2	Room 15	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1026-1	Room 14	SK	App	5.19	6/4/2021	-	-	-	None	-	-	-
1026-2	Room 14	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1027-1	Room 13	SK	App	1.86	6/4/2021	-	-	-	None	-	-	-
1027-2	Room 13	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1028-1	Room 12	SK	App	2.54	6/4/2021	-	-	-	None	-	-	-
1028-2	Room 12	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1029-1	Room 11	SK	App	1.95	6/4/2021	-	-	-	None	-	-	-
1029-2	Room 11	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1029-3	Room 11 Bathroom	SK	App	1.29	6/4/2021	-	-	-	None	-	-	-
1030-1	Custodial Closet by Room 11	SS	N/A		6/4/2021	-	-	-	Locked Door	-	-	-
1031-1	Room 10	SK	App	2.6	6/4/2021	-	-	-	None	-	-	-
1031-2	Room 10	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1031-3	Room 10 Bathroom	SK	App	1.72	6/4/2021	-	-	-	None	-	-	-
1032-1	Room 9 Bathroom	SK	App	2.82	6/4/2021	-	-	-	None	-	-	-
1033-1	Room 7	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1034-1	Room 8	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1035-1	Room 5	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1036-1	Room 6	SK	App	1.81	6/4/2021	-	-	-	None	-	-	-
1037-1	Room 4	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1037-2	Room 4	WF	App	1.37	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1038-1	Room 3	SK	App	3.87	6/4/2021	-	-	-	None	-	-	-
1038-2	Room 3	WF	App	1.77	6/4/2021	-	-	-	None	-	-	-
1039-1	Room 2	SK	App	1.12	6/4/2021	-	-	-	None	-	-	-
1039-2	Room 2	WF	App	1.01	6/4/2021	-	-	-	None	-	-	-
1040-1	Room 1	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1040-2	Room 1	WF	App	69.2	6/4/2021				Additional Sampling Required			
1041-1	Assistant Principal's Office	SK	App	2.28	6/4/2021	-	-	-	None	-	-	-
1041-2	Assistant Principal's Office	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1042-1	Nurse's Office Bathroom	SK	App	1.69	6/4/2021	-	-	-	None	-	-	-
1042-2	Nurse's Office	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1043-1	Main Office Kitchette	SK	App	1.76	6/4/2021	-	-	-	None	-	-	-
1043-2	Main Office	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1043-3	Main Office Bathroom	SK	N/A		6/4/2021	-	-	-		-	-	-
1044-1	Girl's Bathroom by Main Office	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1045-1	Custodial Closet by Main Office	SS	N/A		6/4/2021	-	-	-	Locked Door	-	-	-
1046-1	Boy's Bathroom by Main Office	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1047-1	Unisex Bathroom by Main Office	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1048-1	Unisex Office by Room S	SK	App	4.12	6/4/2021	-	-	-	None	-	-	-
1049-1	Faculty Room Kitchenette	SK	App	1.5	6/4/2021	-	-	-	None	-	-	-
1050-1	Hallway by Gym	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1050-2	Hallway by Gym	BF	App	<1.0	6/4/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1051-1	Gym	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1051-2	Gym	BF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1052-1	Room 34	SK	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1052-2	Room 34	WF	App	<1.0	6/4/2021	-	-	-	None	-	-	-
1053-1	Portable L	WF	App		6/4/2021	-	-	-	None	Removed From Service	-	-
1053-2	Portable L & R Bathroom	SK	App		6/4/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1054-1	Portable R	WF	App	22.2	6/4/2021				Additional Sampling Required			

Laboratory Report

NYE Report #: 2212606-18113

June 8, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Park Avenue School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 04, 2021. New York Environmental analyzed the samples on June 07, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P034	1	Kitchen 2-Bay Unit-SK; Initial	1.00	<1.00	µg/L	
210604P035	2	Kitchen Serving Area Prep Island-SK; Initial	1.00	1.00	µg/L	
210604P036	3	Kitchen 3-Bay Unit Left-SK; Initial	1.00	<1.00	µg/L	
210604P037	4	Kitchen 3-Bay Unit Middle-SK; Initial	1.00	<1.00	µg/L	
210604P038	5	Kitchen 3-Bay Unit Right-SK; Initial	1.00	<1.00	µg/L	
210604P039	6	Kitchen Handwash-SK; Initial	1.00	1.05	µg/L	
210604P040	7	Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
210604P041	8	Room L Band Room Bathroom-SK; Initial	1.00	1.40	µg/L	
210604P042	9	Room 35-SK; Initial	1.00	1.09	µg/L	
210604P043	10	Room 35-WF; Initial	1.00	<1.00	µg/L	
210604P044	11	Room 33-SK; Initial	1.00	<1.00	µg/L	
210604P045	12	Room 33-WF; Initial	1.00	<1.00	µg/L	
210604P046	13	Room 32-SK; Initial	1.00	<1.00	µg/L	
210604P047	14	Room 32-WF; Initial	1.00	<1.00	µg/L	
210604P048	15	Room 31-SK; Initial	1.00	<1.00	µg/L	
210604P049	16	Room 31-WF; Initial	1.00	1.45	µg/L	
210604P050	17	Room 30-SK; Initial	1.00	<1.00	µg/L	
210604P051	18	Room 30-WF; Initial	1.00	<1.00	µg/L	
210604P052	19	Room 29-SK; Initial	1.00	<1.00	µg/L	
210604P053	20	Room 29-WF; Initial	1.00	1.36	µg/L	
210604P054	21	Room 28-SK; Initial	1.00	2.48	µg/L	
210604P055	22	Room 28-WF; Initial	1.00	<1.00	µg/L	
210604P056	23	Room 27-SK; Initial	1.00	3.12	µg/L	
210604P057	24	Room 27-WF; Initial	1.00	1.05	µg/L	
210604P058	25	Room 26-SK; Initial	1.00	2.08	µg/L	
210604P059	26	Room 26-WF; Initial	1.00	<1.00	µg/L	



Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P060	27	Room 25-SK; Initial	1.00	2.28	µg/L	
210604P061	28	Room 25-WF; Initial	1.00	7.76	µg/L	
210604P062	29	Room 24-SK; Initial	1.00	3.49	µg/L	
210604P063	30	Room 24-WF; Initial	1.00	<1.00	µg/L	
210604P064	31	Room 23-SK; Initial	1.00	1.26	µg/L	
210604P065	32	Room 23-WF; Initial	1.00	<1.00	µg/L	
210604P066	33	Girl's Bathroom by Room 23 Left-SK; Initial	1.00	<1.00	µg/L	
210604P067	34	Girl's Bathroom by Room 23 Left Middle-SK; Initial	1.00	<1.00	µg/L	
210604P068	35	Girl's Bathroom by Room 23 Right Middle-SK; Initial	1.00	3.46	µg/L	
210604P069	36	Girl's Bathroom by Room 23 Right-SK; Initial	1.00	1.79	µg/L	
210604P070	37	Boy's Bathroom by Room 23 Left-SK; Initial	1.00	<1.00	µg/L	
210604P071	38	Boy's Bathroom by Room 23 Left Middle-SK; Initial	1.00	1.09	µg/L	
210604P072	39	Boy's Bathroom by Room 23 Middle-SK; Initial	1.00	1.31	µg/L	
210604P073	40	Boy's Bathroom by Room 23 Right Middle-SK; Initial	1.00	1.23	µg/L	
210604P074	41	Boy's Bathroom by Room 23 Right-SK; Initial	1.00	<1.00	µg/L	
210604P075	42	Room 20 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P076	43	Room 21-SK; Initial	1.00	4.53	µg/L	
210604P077	44	Room 21-WF; Initial	1.00	<1.00	µg/L	
210604P078	45	Room 21 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P079	46	Room 22-SK; Initial	1.00	1.76	µg/L	
210604P080	47	Room 22-WF; Initial	1.00	<1.00	µg/L	
210604P081	48	Room 22 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P082	49	Room 19-WF; Initial	1.00	<1.00	µg/L	
210604P083	50	Room 18-SK; Initial	1.00	3.61	µg/L	
210604P084	51	Room 18-WF; Initial	1.00	<1.00	µg/L	
210604P085	52	Room 18 Bathroom-SK; Initial	1.00	<1.00	µg/L	
210604P086	53	Room 19-SK; Initial	1.00	1.44	µg/L	



Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P087	54	Room 17-SK; Initial	1.00	<1.00	µg/L	
210604P088	55	Room 17-WF; Initial	1.00	<1.00	µg/L	
210604P089	56	Room 16-SK; Initial	1.00	1.49	µg/L	
210604P090	57	Room 16-WF; Initial	1.00	<1.00	µg/L	
210604P091	58	Room 15-SK; Initial	1.00	<1.00	µg/L	
210604P092	59	Room 15-WF; Initial	1.00	<1.00	µg/L	
210604P093	60	Room 14-SK; Initial	1.00	5.19	µg/L	
210604P094	61	Room 14-WF; Initial	1.00	<1.00	µg/L	
210604P095	62	Room 13-SK; Initial	1.00	1.86	µg/L	
210604P096	63	Room 13-WF; Initial	1.00	<1.00	µg/L	
210604P097	64	Room 12-SK; Initial	1.00	2.54	µg/L	
210604P098	65	Room 12-WF; Initial	1.00	<1.00	µg/L	
210604P099	66	Room 11-SK; Initial	1.00	1.95	µg/L	
210604P100	67	Room 11-WF; Initial	1.00	<1.00	µg/L	
210604P101	68	Room 11- Bathroom-SK; Initial	1.00	1.29	µg/L	
210604P102	69	Room 10-SK; Initial	1.00	2.60	µg/L	
210604P103	70	Room 10-WF; Initial	1.00	<1.00	µg/L	
210604P104	71	Room 10 Bathroom-SK; Initial	1.00	1.72	µg/L	
210604P105	72	Room 9 Bathroom-SK; Initial	1.00	2.82	µg/L	
210604P106	73	Room 7-SK; Initial	1.00	<1.00	µg/L	
210604P107	74	Room 8-SK; Initial	1.00	<1.00	µg/L	
210604P108	75	Room 5-SK; Initial	1.00	<1.00	µg/L	
210604P109	76	Room 6-SK; Initial	1.00	1.81	µg/L	
210604P110	77	Room 4-SK; Initial	1.00	<1.00	µg/L	
210604P111	78	Room 4-WF; Initial	1.00	1.37	µg/L	
210604P112	79	Room 3-SK; Initial	1.00	3.87	µg/L	
210604P113	80	Room 3-WF; Initial	1.00	1.77	µg/L	



Date Collected:	04 Jun 2021
Date Received:	04 Jun 2021
Date Analyzed:	07 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210604P114	81	Room 2-SK; Initial	1.00	1.12	µg/L	
210604P115	82	Room 2-WF; Initial	1.00	1.01	µg/L	
210604P116	83	Room 1-SK; Initial	1.00	<1.00	µg/L	
210604P117	84	Room 1-WF; Initial	1.00	69.2	µg/L	E,H
210604P118	85	Assistant Principal's Office-SK; Initial	1.00	2.28	µg/L	
210604P119	86	Nurse's Office Bathroom-SK; Initial	1.00	1.69	µg/L	
210604P120	87	Nurse's Office-SK; Initial	1.00	<1.00	µg/L	
210604P121	88	Main Office Kitchette-SK; Initial	1.00	1.76	µg/L	
210604P122	89	Girl's Bathroom by Main Office-SK; Initial	1.00	<1.00	µg/L	
210604P123	90	Boy's Bathroom by Main Office-SK; Initial	1.00	<1.00	µg/L	
210604P124	91	Unisex Bathroom by Main Office-SK; Initial	1.00	<1.00	µg/L	
210604P125	92	Unisex Office by Room S-SK; Initial	1.00	4.12	µg/L	
210604P126	93	Faculty Room Kitchenette-SK; Initial	1.00	1.50	µg/L	
210604P127	94	Hallway by Gym-BF; Initial	1.00	<1.00	µg/L	
210604P128	95	Gym-BF; Initial	1.00	<1.00	µg/L	
210604P129	96	Room 34-SK; Initial	1.00	<1.00	µg/L	
210604P130	97	Room 34-WF; Initial	1.00	<1.00	µg/L	
210604P131	98	Portable R-WF; Initial	1.00	22.2	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Ice Machine	IM	App	1.52	6/3/2021	-	-	-	None	-	-	-
1001-2	Kitchen 3-Bay (Right)	SK	App	1.07	6/3/2021	-	-	-	None	-	-	-
1001-3	Kitchen 3-Bay (Left)	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-4	Kitchen Handwash	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-5	Kitchen Pot Filler	SP	App		6/3/2021	-	-	-	None	Removed from service	-	-
1002-1	Custodian Bathroom by Kitchen	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1003-1	Faculty Room	SK	App	2.38	6/3/2021	-	-	-	None	-	-	-
1004-1	Boys Bathroom by Room 12 (Left)	SK	App	4.69	6/3/2021	-	-	-	None	-	-	-
1004-2	Boys Bathroom by Room 12 (Middle Left)	SK	App	2.26	6/3/2021	-	-	-	None	-	-	-
1004-3	Boys Bathroom by Room 12 (Middle Right)	SK	App	1.42	6/3/2021	-	-	-	None	-	-	-
1004-4	Boys Bathroom by Room 12 (Right)	SK	App	1.52	6/3/2021	-	-	-	None	-	-	-
1005-1	Custodian Closet by Room 12	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1006-1	Girls Bathroom by Room 12 (Left)	SK	App	2.66	6/3/2021	-	-	-	None	-	-	-
1006-2	Girls Bathroom by Room 12 (Middle)	SK	App	2.01	6/3/2021	-	-	-	None	-	-	-
1006-3	Girls Bathroom by Room 12 (Right)	SK	App	1.5	6/3/2021	-	-	-	None	-	-	-
1007-1	Room 13	SK	App	6.57	6/3/2021	-	-	-	None	-	-	-
1008-1	Room 15	SK	App	3.66	6/3/2021	-	-	-	None	-	-	-
1009-1	Room 17	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1009-2	Room 17	SK	App	2.36	6/3/2021	-	-	-	None	-	-	-
1010-1	Room 19	WF	App	8.18	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-2	Room 19	SK	App	3	6/3/2021	-	-	-	None	-	-	-
1011-1	Room 23	SK	App	1	6/3/2021	-	-	-	None	-	-	-
1012-1	Room 25	SK	App	1.93	6/3/2021	-	-	-	None	-	-	-
1013-1	Room 26	SK	App	3.59	6/3/2021	-	-	-	None	-	-	-
1014-1	Room 24	SK	App	1.34	6/3/2021	-	-	-	None	-	-	-
1015-1	Room 20	SK	App	1.46	6/3/2021	-	-	-	None	-	-	-
1016-1	Room 18	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1016-2	Room 18	SK	App	15.6	6/3/2021				Additional Sampling Required			
1017-1	Room 16	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1017-2	Room 16	SK	App	5.59	6/3/2021	-	-	-	None	-	-	-
1018-1	Room 14	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1018-2	Room 14	SK	App	2.53	6/3/2021	-	-	-	None	-	-	-
1019-1	Room 12	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1020-1	Hall by Gym	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1020-2	Hall by Gym (Bottle Filler)	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1021-1	Main Office	SK	App	2.87	6/3/2021	-	-	-	None	-	-	-
1022-1	Principal's Office Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1023-1	Faculty Bathroom by Main Office	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1024-1	Faculty Bathroom by Room "A"	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1025-1	Room "A"	SK	App	1.84	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-1	Room 11	SK	App	3.39	6/3/2021	-	-	-	None	-	-	-
1027-1	Nurse's Office	SK	App	9.6	6/3/2021	-	-	-	None	-	-	-
1027-2	Nurse's Office Bathroom	SK	App	1.28	6/3/2021	-	-	-	None	-	-	-
1028-1	Room 10	WF	App	1.27	6/3/2021	-	-	-	None	-	-	-
1028-2	Room 10	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1028-3	Room 10 Bathroom	SK	App	2.24	6/3/2021	-	-	-	None	-	-	-
1029-1	Room 8	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1029-2	Room 8	SK	App	23.8	6/3/2021				Additional Sampling Required			
1029-3	Room 8 Bathroom	SK	App	3.15	6/3/2021	-	-	-	None	-	-	-
1030-1	Room 6	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1030-2	Room 6	SK	App	10.7	6/3/2021	-	-	-	None	-	-	-
1030-3	Room 6 Bathroom	SK	App	2.23	6/3/2021	-	-	-	None	-	-	-
1031-1	Room 4	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1031-2	Room 4	SK	App	1.69	6/3/2021	-	-	-	None	-	-	-
1031-3	Room 4 Bathroom	SK	App	3.14	6/3/2021	-	-	-	None	-	-	-
1032-1	Room 2	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1032-2	Room 2	SK	App	1.05	6/3/2021	-	-	-	None	-	-	-
1032-3	Room 2 Bathroom	SK	App	16	6/3/2021				Additional Sampling Required			
1033-1	Room "F"	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1033-2	Room "F"	SK	App		6/3/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-3	Room "F" Bathroom	SK	App	36.8	6/3/2021				Additional Sampling Required			
1034-1	Room "G"	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1034-2	Room "G"	SK	App	14.5	6/3/2021	-	-	-	None	-	-	-
1034-3	Room "G" Bathroom	SK	App	3.79	6/3/2021	-	-	-	None	-	-	-
1035-1	Room 1	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1035-2	Room 1	SK	App	4.42	6/3/2021	-	-	-	None	-	-	-
1035-3	Room 1 Bathroom	SK	App	2.37	6/3/2021	-	-	-	None	-	-	-
1036-1	Room 3	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1036-2	Room 3	SK	App	3.97	6/3/2021	-	-	-	None	-	-	-
1036-3	Room 3 Bathroom	SK	App	3.39	6/3/2021	-	-	-	None	-	-	-
1037-1	Room 5	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1037-2	Room 5	SK	App	1.72	6/3/2021	-	-	-	None	-	-	-
1037-3	Room 5 Bathroom	SK	App	2.37	6/3/2021	-	-	-	None	-	-	-
1038-1	Computer Room 7 Bathroom	SK	App	1.2	6/3/2021	-	-	-	None	-	-	-
1039-1	Custodian Closet by Library Room 9	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1040-1	Library Room 9 Kitchenette	SK	App	5.62	6/3/2021	-	-	-	None	-	-	-
0001-1	Boiler Room Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Ice Machine	IM	App	1.52	6/3/2021	-	-	-	None	-	-	-
1001-2	Kitchen 3-Bay (Right)	SK	App	1.07	6/3/2021	-	-	-	None	-	-	-
1001-3	Kitchen 3-Bay (Left)	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-4	Kitchen Handwash	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-5	Kitchen Pot Filler	SP	App		6/3/2021	-	-	-	None	Removed from service	-	-
1002-1	Custodian Bathroom by Kitchen	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1003-1	Faculty Room	SK	App	2.38	6/3/2021	-	-	-	None	-	-	-
1004-1	Boys Bathroom by Room 12 (Left)	SK	App	4.69	6/3/2021	-	-	-	None	-	-	-
1004-2	Boys Bathroom by Room 12 (Middle Left)	SK	App	2.26	6/3/2021	-	-	-	None	-	-	-
1004-3	Boys Bathroom by Room 12 (Middle Right)	SK	App	1.42	6/3/2021	-	-	-	None	-	-	-
1004-4	Boys Bathroom by Room 12 (Right)	SK	App	1.52	6/3/2021	-	-	-	None	-	-	-
1005-1	Custodian Closet by Room 12	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1006-1	Girls Bathroom by Room 12 (Left)	SK	App	2.66	6/3/2021	-	-	-	None	-	-	-
1006-2	Girls Bathroom by Room 12 (Middle)	SK	App	2.01	6/3/2021	-	-	-	None	-	-	-
1006-3	Girls Bathroom by Room 12 (Right)	SK	App	1.5	6/3/2021	-	-	-	None	-	-	-
1007-1	Room 13	SK	App	6.57	6/3/2021	-	-	-	None	-	-	-
1008-1	Room 15	SK	App	3.66	6/3/2021	-	-	-	None	-	-	-
1009-1	Room 17	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1009-2	Room 17	SK	App	2.36	6/3/2021	-	-	-	None	-	-	-
1010-1	Room 19	WF	App	8.18	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-2	Room 19	SK	App	3	6/3/2021	-	-	-	None	-	-	-
1011-1	Room 23	SK	App	1	6/3/2021	-	-	-	None	-	-	-
1012-1	Room 25	SK	App	1.93	6/3/2021	-	-	-	None	-	-	-
1013-1	Room 26	SK	App	3.59	6/3/2021	-	-	-	None	-	-	-
1014-1	Room 24	SK	App	1.34	6/3/2021	-	-	-	None	-	-	-
1015-1	Room 20	SK	App	1.46	6/3/2021	-	-	-	None	-	-	-
1016-1	Room 18	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1016-2	Room 18	SK	App	15.6	6/3/2021				Additional Sampling Required			
1017-1	Room 16	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1017-2	Room 16	SK	App	5.59	6/3/2021	-	-	-	None	-	-	-
1018-1	Room 14	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1018-2	Room 14	SK	App	2.53	6/3/2021	-	-	-	None	-	-	-
1019-1	Room 12	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1020-1	Hall by Gym	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1020-2	Hall by Gym (Bottle Filler)	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1021-1	Main Office	SK	App	2.87	6/3/2021	-	-	-	None	-	-	-
1022-1	Principal's Office Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1023-1	Faculty Bathroom by Main Office	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1024-1	Faculty Bathroom by Room "A"	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1025-1	Room "A"	SK	App	1.84	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1026-1	Room 11	SK	App	3.39	6/3/2021	-	-	-	None	-	-	-
1027-1	Nurse's Office	SK	App	9.6	6/3/2021	-	-	-	None	-	-	-
1027-2	Nurse's Office Bathroom	SK	App	1.28	6/3/2021	-	-	-	None	-	-	-
1028-1	Room 10	WF	App	1.27	6/3/2021	-	-	-	None	-	-	-
1028-2	Room 10	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1028-3	Room 10 Bathroom	SK	App	2.24	6/3/2021	-	-	-	None	-	-	-
1029-1	Room 8	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1029-2	Room 8	SK	App	23.8	6/3/2021				Additional Sampling Required			
1029-3	Room 8 Bathroom	SK	App	3.15	6/3/2021	-	-	-	None	-	-	-
1030-1	Room 6	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1030-2	Room 6	SK	App	10.7	6/3/2021	-	-	-	None	-	-	-
1030-3	Room 6 Bathroom	SK	App	2.23	6/3/2021	-	-	-	None	-	-	-
1031-1	Room 4	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1031-2	Room 4	SK	App	1.69	6/3/2021	-	-	-	None	-	-	-
1031-3	Room 4 Bathroom	SK	App	3.14	6/3/2021	-	-	-	None	-	-	-
1032-1	Room 2	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1032-2	Room 2	SK	App	1.05	6/3/2021	-	-	-	None	-	-	-
1032-3	Room 2 Bathroom	SK	App	16	6/3/2021				Additional Sampling Required			
1033-1	Room "F"	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1033-2	Room "F"	SK	App		6/3/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-3	Room "F" Bathroom	SK	App	36.8	6/3/2021				Additional Sampling Required			
1034-1	Room "G"	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1034-2	Room "G"	SK	App	14.5	6/3/2021	-	-	-	None	-	-	-
1034-3	Room "G" Bathroom	SK	App	3.79	6/3/2021	-	-	-	None	-	-	-
1035-1	Room 1	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1035-2	Room 1	SK	App	4.42	6/3/2021	-	-	-	None	-	-	-
1035-3	Room 1 Bathroom	SK	App	2.37	6/3/2021	-	-	-	None	-	-	-
1036-1	Room 3	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1036-2	Room 3	SK	App	3.97	6/3/2021	-	-	-	None	-	-	-
1036-3	Room 3 Bathroom	SK	App	3.39	6/3/2021	-	-	-	None	-	-	-
1037-1	Room 5	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1037-2	Room 5	SK	App	1.72	6/3/2021	-	-	-	None	-	-	-
1037-3	Room 5 Bathroom	SK	App	2.37	6/3/2021	-	-	-	None	-	-	-
1038-1	Computer Room 7 Bathroom	SK	App	1.2	6/3/2021	-	-	-	None	-	-	-
1039-1	Custodian Closet by Library Room 9	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1040-1	Library Room 9 Kitchenette	SK	App	5.62	6/3/2021	-	-	-	None	-	-	-
0001-1	Boiler Room Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-

Laboratory Report

NYE Report #: 2212576-18096

June 4, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Powells Lane Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 03, 2021. New York Environmental analyzed the samples on June 04, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P124	1	Kitchen Ice Machine-IM; Initial	1.00	1.52	µg/L	
210603P125	2	Kitchen 3-Bay (Right)-SK; Initial	1.00	1.07	µg/L	
210603P126	3	Kitchen 3-Bay (Left)-SK; Initial	1.00	<1.00	µg/L	
210603P127	4	Kitchen Handwash-SK; Initial	1.00	<1.00	µg/L	
210603P128	5	Faculty Room-SK; Initial	1.00	2.38	µg/L	
210603P129	6	Boys Bathroom by Room 12 (Left)-SK; Initial	1.00	4.69	µg/L	
210603P130	7	Boys Bathroom by Room 12 (Middle Left)-SK; Initial	1.00	2.26	µg/L	
210603P131	8	Boys Bathroom by Room 12 (Middle Right)-SK; Initial	1.00	1.42	µg/L	
210603P132	9	Boys Bathroom by Room 12 (Right)-SK; Initial	1.00	1.52	µg/L	
210603P133	10	Girls Bathroom by Room 12 (Left)-SK; Initial	1.00	2.66	µg/L	
210603P134	11	Girls Bathroom by Room 12 (Middle)-SK; Initial	1.00	2.01	µg/L	
210603P135	12	Girls Bathroom by Room 12 (Right)-SK; Initial	1.00	1.50	µg/L	
210603P136	13	Room 13-SK; Initial	1.00	6.57	µg/L	
210603P137	14	Room 15-SK; Initial	1.00	3.66	µg/L	
210603P138	15	Room 17-SK; Initial	1.00	2.36	µg/L	
210603P139	16	Room 19-WF; Initial	1.00	8.18	µg/L	
210603P140	17	Room 19-SK; Initial	1.00	3.00	µg/L	
210603P141	18	Room 23-SK; Initial	1.00	1.00	µg/L	
210603P142	19	Room 25-SK; Initial	1.00	1.93	µg/L	
210603P143	20	Room 26-SK; Initial	1.00	3.59	µg/L	
210603P144	21	Room 24-SK; Initial	1.00	1.34	µg/L	
210603P145	22	Room 20-SK; Initial	1.00	1.46	µg/L	
210603P146	23	Room 18-SK; Initial	1.00	15.6	µg/L	H
210603P147	24	Room 16-SK; Initial	1.00	5.59	µg/L	
210603P148	25	Room 14-SK; Initial	1.00	2.53	µg/L	
210603P149	26	Room 12-SK; Initial	1.00	<1.00	µg/L	



Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P150	27	Hall by Gym (Bottle Filler)-BF; Initial	1.00	<1.00	µg/L	
210603P151	28	Main Office-SK; Initial	1.00	2.87	µg/L	
210603P152	29	Room "A"-SK; Initial	1.00	1.84	µg/L	
210603P153	30	Room 11-SK; Initial	1.00	3.39	µg/L	
210603P154	31	Nurse's Office-SK; Initial	1.00	9.60	µg/L	
210603P155	32	Nurse's Office Bathroom-SK; Initial	1.00	1.28	µg/L	
210603P156	33	Room 10-WF; Initial	1.00	1.27	µg/L	
210603P157	34	Room 10-SK; Initial	1.00	<1.00	µg/L	
210603P158	35	Room 10 Bathroom-SK; Initial	1.00	2.24	µg/L	
210603P159	36	Room 8-SK; Initial	1.00	23.8	µg/L	H
210603P160	37	Room 8 Bathroom-SK; Initial	1.00	3.15	µg/L	
210603P161	38	Room 6 -SK; Initial	1.00	10.7	µg/L	
210603P162	39	Room 6 Bathroom-SK; Initial	1.00	2.23	µg/L	
210603P163	40	Room 4-SK; Initial	1.00	1.69	µg/L	
210603P164	41	Room 4 Bathroom-SK; Initial	1.00	3.14	µg/L	
210603P165	42	Room 2-SK; Initial	1.00	1.05	µg/L	
210603P166	43	Room 2 Bathroom-SK; Initial	1.00	16.0	µg/L	H
210603P167	44	Room "F" Bathroom-SK; Initial	1.00	36.8	µg/L	H
210603P168	45	Room "G" -SK; Initial	1.00	14.5	µg/L	
210603P169	46	Room "G" Bathroom-SK; Initial	1.00	3.79	µg/L	
210603P170	47	Room 1-SK; Initial	1.00	4.42	µg/L	
210603P171	48	Room 1 Bathroom-SK; Initial	1.00	2.37	µg/L	
210603P172	49	Room 3-SK; Initial	1.00	3.97	µg/L	
210603P173	50	Room 3 Bathroom-SK; Initial	1.00	3.39	µg/L	
210603P174	51	Room 5 -SK; Initial	1.00	1.72	µg/L	
210603P175	52	Room 5 Bathroom-SK; Initial	1.00	2.37	µg/L	
210603P176	53	Computer Room 7 Bathroom-SK; Initial	1.00	1.20	µg/L	

Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210603P177	54	Library Room 9 Kitchenette-SK; Initial	1.00	5.62	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.

Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Boiler Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
0001-2	Boiler Room Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
0002-2	Bathroom by Wood Shop	SK	App	145	6/3/2021				Additional Sampling Required			
0003-1	Room B21	SK	App	10	6/3/2021	-	-	-	None	-	-	-
0003-2	Room B21	WF	App	1.56	6/3/2021	-	-	-	None	-	-	-
0004-1	Room B20-Wood Shop	SK	App	6.72	6/3/2021	-	-	-	None	-	-	-
0004-2	Room B20-Wood Shop	WF	App	8.68	6/3/2021	-	-	-	None	-	-	-
1001-1	Kitchen-Handwash	SK	N/A		6/3/2021	-	-	-	None	Removed from Service	-	-
1001-2	Kitchen-3 Bay Unit-Left	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-3	Kitchen-3 Bay Unit-Middle	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-4	Kitchen-3 Bay Unit-Right	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-5	Kitchen-2 Bay Unit	SK	App	2	6/3/2021	-	-	-	None	-	-	-
1001-6	Kitchen-Serving Area-3 Bay Unit	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-7	Kitchen-Serving Area-3 Bay Unit	IM	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-8	Kitchen-Serving Area-Handwash	SK	App	8.07	6/3/2021	-	-	-	None	-	-	-
1002-1	Cafeteria	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1003-1	Team Room	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1003-2	Team Room Bathroom	SK	App	4.11	6/3/2021	-	-	-	None	-	-	-
1004-1	Custodial Closet by Girl's Locker Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1005-1	Girl's Locker Room Bathroom-Left	SK	App	1.02	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1005-2	Girl's Locker Room Bathroom-Right	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1006-1	Boy's Bathroom by Room 114	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1007-1	Boy's Coach's Office Bathroom	SK	N/A		6/3/2021	-	-	-	None	Removed from Service	-	-
1007-2	Boy's Locker Room Bathroom-Left	SK	App	3.69	6/3/2021	-	-	-	None	-	-	-
1007-3	Boy's Locker Room Bathroom-Right	SK	App	3.21	6/3/2021	-	-	-	None	-	-	-
1008-1	Custodial Closet by Room 114	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1009-1	Hallway by Room 114	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1009-2	Hallway by Room 114	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1010-1	Girl's Bathroom by Room 112-Left	SK	App	1.18	6/3/2021	-	-	-	None	-	-	-
1010-2	Girl's Bathroom by Room 112-Right	SK	App	1.08	6/3/2021	-	-	-	None	-	-	-
1011-1	Art Room 110-Left	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1011-2	Art Room 110-Right	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1012-1	Guidance Office Bathroom	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-1	Women's Bathroom by Guidance Office @A	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-2	Women's Bathroom by Guidance Office @B	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-3	Women's Bathroom by Guidance Office @C	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-4	Women's Bathroom by Guidance Office @D	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-5	Women's Bathroom by Guidance Office @E	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1013-6	Women's Bathroom by Guidance Office @F	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1014-1	Hallway by Nurse's Office	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1015-1	Nurse's Office Bathroom	SK	App	2.97	6/3/2021	-	-	-	None	-	-	-
1015-2	Nurse's Office	SK	App	264	6/3/2021				Additional Sampling Required			
1015-3	Nurse's Office Exam Room	SK	App	612	6/3/2021				Additional Sampling Required			
1016-1	Men's Bathroom by Main Office @A	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-2	Men's Bathroom by Main Office @B	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-3	Men's Bathroom by Main Office @C	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1016-4	Men's Bathroom by Main Office @D	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1017-1	Custodial Closet by Main Office	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1018-1	Hallway by Room 109	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1019-1	Principal's Office Bathroom	SK	App	1.71	6/3/2021	-	-	-	None	-	-	-
1020-1	Room 102-Home Economics @A	SK	App	5.86	6/3/2021	-	-	-	None	-	-	-
1020-2	Room 102-Home Economics @A	SPY	App	2.46	6/3/2021	-	-	-	None	-	-	-
1020-3	Room 102-Home Economics @B	SK	App	9.25	6/3/2021	-	-	-	None	-	-	-
1020-4	Room 102-Home Economics @B	SPY	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1021-1	Room 100-Home Economics @A	SK	App	84	6/3/2021				Additional Sampling Required			
1021-2	Room 100-Home Economics @B	SK	App	30.3	6/3/2021				Additional Sampling Required			
1021-3	Room 100-Home Economics @C	SK	App	5.81	6/3/2021	-	-	-	None	-	-	-
1021-4	Room 100-Home Economics @C	SPY	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1021-5	Room 100-Home Economics @D	SK	App	1.24	6/3/2021	-	-	-	None	-	-	-
1021-6	Room 100-Home Economics @E	SK	App	2.25	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1022-1	Room 101-Art Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1023-1	Custodial Storage on Stage	SS	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1024-1	Auditorium by Girl's Bathroom	WF	App	11.2	6/3/2021	-	-	-	None	-	-	-
1025-1	Girl's Bathroom in Auditorium-Left	SK	App	5	6/3/2021	-	-	-	None	-	-	-
1025-2	Girl's Bathroom in Auditorium-Right	SK	App	7.1	6/3/2021	-	-	-	None	-	-	-
1026-1	Auditorium by Boy's Bathroom	WF	App	12.8	6/3/2021	-	-	-	None	-	-	-
1027-1	Boy's Bathroom in Auditorium-Left	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1027-2	Boy's Bathroom in Auditorium-Right	SK	App	65.8	6/3/2021				Additional Sampling Required			
1028-1	Girl's Bathroom by Library-Left	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1028-2	Girl's Bathroom by Library-Right	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1029-1	Hallway by Library	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1030-1	Library Office	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-1	Boy's Bathroom by Room 2-Left	SK	App	2.68	6/3/2021	-	-	-	None	-	-	-
1031-2	Boy's Bathroom by Room 2-Middle	SK	App	1.74	6/3/2021	-	-	-	None	-	-	-
1031-3	Boy's Bathroom by Room 2-Right	SK	App	1.14	6/3/2021	-	-	-	None	-	-	-
1032-1	Custodial Closet by Room 2	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1033-1	Hallway by Room 4	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
1033-2	Hallway by Room 4	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1034-1	Stairway by Room 117	SK	App	2.25	6/3/2021	-	-	-	None	-	-	-
1035-1	Room 119	SK	App	2.68	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-1	Girl's Bathroom. By Psych Office @A	SK	App	2.09	6/3/2021	-	-	-	None	-	-	-
2001-2	Girl's Bathroom. By Psych Office @B	SK	App	2.07	6/3/2021	-	-	-	None	-	-	-
2001-3	Girl's Bathroom. By Psych Office @C	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
2001-4	Girl's Bathroom. By Psych Office @D	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
2002-1	Hallway by Room 207	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
2003-1	Room 207-Science	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2004-1	Room 209-Science-Counter	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2004-2	Room 209-Science-Island 1	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2004-3	Room 209-Science-Island 2	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2005-1	Room 211 Prep Room-Counter @A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2005-2	Room 211 Prep Room-Counter @B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2005-3	Room 211 Prep Room-Counter @C	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2005-4	Room 211 Prep Room	SS	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2005-5	Room 211-Science	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2006-1	Room 209-Counter	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2007-1	Room 210-Counter @A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2007-2	Room 210-Counter @B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2007-3	Room 210-Counter @C	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
2008-1	Hallway by Room 200	WF	App		6/3/2021	-	-	-	None	Removed from Service	-	-
2009-1	Custodial Closet by Room 200	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2010-1	Boy's Bathroom by Room 200-Left	SK	App	2.92	6/3/2021	-	-	-	None	-	-	-
2010-2	Boy's Bathroom by Room 200-Left Middle	SK	App		6/3/2021	-	-	-	None	Removed from Service	-	-
2010-3	Boy's Bathroom by Room 200-Right Middle	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
2010-4	Boy's Bathroom by Room 200-Right	SK	App	1.24	6/3/2021	-	-	-	None	-	-	-
2011-1	Room 206 Island	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
3001-1	Boy's Bathroom by Room 303-Left	SK	App	2.21	6/3/2021	-	-	-	None	-	-	-
3001-2	Boy's Bathroom by Room 303-Right	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
3002-1	Hallway by Room 303	WF	App		6/3/2021	-	-	-	None	-	-	-
3003-1	Assistant Principal's Office Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
3004-1	Girl's Bathroom-Custodial Closet	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
3004-2	Girl's Bathroom by Room 304-Left	SK	App	2	6/3/2021	-	-	-	None	-	-	-
3004-3	Girl's Bathroom by Room 304-Middle	SK	App	1.45	6/3/2021	-	-	-	None	-	-	-
3004-4	Girl's Bathroom by Room 304-Right	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
3005-1	Room 307-Left	SK	App	28.1	6/3/2021				Additional Sampling Required			
3005-2	Room 307-Right	SK	App	163	6/3/2021				Additional Sampling Required			

Laboratory Report

NYE Report #: 2212577-18097

June 7, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Westbury Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 03, 2021. New York Environmental analyzed the samples on June 04, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P178	1	Kitchen-3 Bay Unit-Left-SK; Initial	1.00	<1.00	µg/L	
210603P179	2	Kitchen-3 Bay Unit-Middle-SK; Initial	1.00	<1.00	µg/L	
210603P180	3	Kitchen-3 Bay Unit-Right-SK; Initial	1.00	<1.00	µg/L	
210603P181	4	Kitchen-2 Bay Unit-SK; Initial	1.00	1.00	µg/L	
210603P182	5	Kitchen-Serving Area-3 Bay Unit-SK; Initial	1.00	<1.00	µg/L	
210603P183	6	Kitchen-Serving Area-3 Bay Unit-IM; Initial	1.00	<1.00	µg/L	
210603P184	7	Kitchen-Serving Area-Handwash-SK; Initial	1.00	8.07	µg/L	
210603P185	8	Team Room Bathroom-SK; Initial	1.00	4.11	µg/L	
210603P186	9	Girl's Locker Room Bathroom-Left-SK; Initial	1.00	1.02	µg/L	
210603P187	10	Boy's Bathroom by Room 114-SK; Initial	1.00	<1.00	µg/L	
210603P188	11	Boy's Locker Room Bathroom-Left-SK; Initial	1.00	3.69	µg/L	
210603P189	12	Boy's Locker Room Bathroom-Right-SK; Initial	1.00	3.21	µg/L	
210603P190	13	Hallway by Room 114-BF; Initial	1.00	<1.00	µg/L	
210603P191	14	Girl's Bathroom by Room 112-Left-SK; Initial	1.00	1.18	µg/L	
210603P192	15	Girl's Bathroom by Room 112-Right-SK; Initial	1.00	1.08	µg/L	
210603P193	16	Nurse's Office Bathroom-SK; Initial	1.00	2.97	µg/L	
210603P194	17	Nurse's Office-SK; Initial	1.00	264	µg/L	E,H
210603P195	18	Nurse's Office Exam Room-SK; Initial	1.00	61.0	µg/L	E,H
210603P196	19	Principal's Office Bathroom-SK; Initial	1.00	1.71	µg/L	
210603P197	20	Room 102-Home Economics @A-SK; Initial	1.00	5.86	µg/L	
210603P198	21	Room 102-Home Economics @A-SPY; Initial	1.00	2.46	µg/L	
210603P199	22	Room 102-Home Economics @B-SK; Initial	1.00	9.25	µg/L	
210603P200	23	Room 100-Home Economics @A-SK; Initial	1.00	84.0	µg/L	E,H
210603P201	24	Room 100-Home Economics @B-SK; Initial	1.00	30.3	µg/L	H
210603P202	25	Room 100-Home Economics @C-SK; Initial	1.00	5.81	µg/L	
210603P203	26	Room 100-Home Economics @D-SK; Initial	1.00	1.24	µg/L	



Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P204	27	Room 100-Home Economics @E-SK; Initial	1.00	2.25	µg/L	
210603P205	28	Auditorium by Girl's Bathroom-WF; Initial	1.00	11.2	µg/L	
210603P206	29	Girl's Bathroom in Auditorium-Left-SK; Initial	1.00	5.00	µg/L	
210603P207	30	Girl's Bathroom in Auditorium-Right-SK; Initial	1.00	7.10	µg/L	
210603P208	31	Auditorium by Boy's Bathroom-WF; Initial	1.00	12.8	µg/L	
210603P209	32	Boy's Bathroom in Auditorium-Right-SK; Initial	1.00	65.8	µg/L	E,H
210603P210	33	Boy's Bathroom by Room 303-Left-SK; Initial	1.00	2.21	µg/L	
210603P211	34	Boy's Bathroom by Room 303-Right-SK; Initial	1.00	<1.00	µg/L	
210603P212	35	Girl's Bathroom by Room 304-Left-SK; Initial	1.00	2.00	µg/L	
210603P213	36	Girl's Bathroom by Room 304-Middle-SK; Initial	1.00	1.45	µg/L	
210603P214	37	Girl's Bathroom by Room 304-Right-SK; Initial	1.00	<1.00	µg/L	
210603P215	38	Room 307-Left-SK; Initial	1.00	28.1	µg/L	H
210603P216	39	Room 307-Right-SK; Initial	1.00	163	µg/L	E,H
210603P217	40	Girl's Bathroom. By Psych Office @A-SK; Initial	1.00	2.09	µg/L	
210603P218	41	Girl's Bathroom. By Psych Office @B-SK; Initial	1.00	2.07	µg/L	
210603P219	42	Girl's Bathroom. By Psych Office @C-SK; Initial	1.00	<1.00	µg/L	
210603P220	43	Boy's Bathroom by Room 200-Left-SK; Initial	1.00	2.92	µg/L	
210603P221	44	Boy's Bathroom by Room 200-Right Middle-SK; Initial	1.00	<1.00	µg/L	
210603P222	45	Boy's Bathroom by Room 200-Right-SK; Initial	1.00	1.24	µg/L	
210603P223	46	Girl's Bathroom by Library-Left-SK; Initial	1.00	<1.00	µg/L	
210603P224	47	Boy's Bathroom by Room 2-Left-SK; Initial	1.00	2.68	µg/L	
210603P225	48	Boy's Bathroom by Room 2-Middle-SK; Initial	1.00	1.74	µg/L	
210603P226	49	Boy's Bathroom by Room 2-Right-SK; Initial	1.00	1.14	µg/L	
210603P227	50	Hallway by Room 4-BF; Initial	1.00	<1.00	µg/L	
210603P228	51	Bathroom by Wood Shop-SK; Initial	1.00	145	µg/L	E,H
210603P229	52	Room B21-SK; Initial	1.00	10.0	µg/L	
210603P230	53	Room B21-WF; Initial	1.00	1.56	µg/L	



Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P231	54	Room B20-Wood Shop-SK; Initial	1.00	6.72	µg/L	
210603P232	55	Room B20-Wood Shop-WF; Initial	1.00	8.68	µg/L	
210603P233	56	Stairway by Room 117-SK; Initial	1.00	2.25	µg/L	
210603P234	57	Room 119-SK; Initial	1.00	2.68	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

Appendix F

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-01	Custodial Office Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1001-01	Kitchen Staff Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1001-02	Kitchen Ice Machine	IM	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-03	Kitchen 2-Bay	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-04	Kitchen 3-Bay Left	SK	App	1.51	6/3/2021	-	-	-	None	-	-	-
1001-05	Kitchen 3-Bay Right	SK	App	2.57	6/3/2021	-	-	-	None	-	-	-
1001-06	Kitchen Prep in Corner	SK	App	6.14	6/3/2021	-	-	-	None	-	-	-
1001-07	Kitchen Prepby Serving Line	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1001-08	Kitchen Island	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1002-01	Main Cafeteria	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1002-02	Main Cafeteria Deli Handwash	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1003-01	Hall by Main Entrance	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1003-02	Hall by Main Entrance	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1004-01	Main Lobby Girl's Bathroom Left	SK	App	19.5	6/3/2021				Additional Sampling Required			
1004-02	Main Lobby Girl's Bathroom Left Middle	SK	App	9.69	6/3/2021	-	-	-	None	-	-	-
1004-03	Main Lobby Girl's Bathroom Right Middle	SK	App	6.79	6/3/2021	-	-	-	None	-	-	-
1004-04	Main Lobby Girl's Bathroom Right	SK	App	9.93	6/3/2021	-	-	-	None	-	-	-
1005-01	Main Lobby Boy's Bathroom Left	SK	App	3.18	6/3/2021	-	-	-	None	-	-	-
1005-02	Main Lobby Boy's Bathroom Right	SK	App	2.06	6/3/2021	-	-	-	None	-	-	-
1006-01	Custodial Closet in Main Lobby	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-01	Principal's Office Bathroom	SK	App	4.12	6/3/2021	-	-	-	None	-	-	-
1008-01	Nurse's Office Bathroom	SK	App	6.75	6/3/2021	-	-	-	None	-	-	-
1008-02	Nurse's Office	SK	App	7.72	6/3/2021	-	-	-	None	-	-	-
1009-01	Faculty Room Men's Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1009-02	Faculty Room	WF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1009-03	Faculty Room	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1009-04	Faculty Room	SK	App	1.23	6/3/2021	-	-	-	None	-	-	-
1009-05	Faculty Room Women's Bathroom	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1010-01	Girl's Bathroom by Suite 112 Social Worker	SK	App	1.39	6/3/2021	-	-	-	None	-	-	-
1011-01	Hall by Room 111	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1012-01	Boy's Bathroom by Suite 112 Social Worker	SK	App	2.63	6/3/2021	-	-	-	None	-	-	-
1013-01	Band Room	SK	App	10.8	6/3/2021	-	-	-	None	-	-	-
1013-02	Band Room Office	SK	App	7.99	6/3/2021	-	-	-	None	-	-	-
1014-01	Boy's Bathroom by Room 119 Left	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1014-02	Boy's Bathroom by Room 119 Right	SK	App	1.74	6/3/2021	-	-	-	None	-	-	-
1015-01	Custodial Closet A-4 by Room 118	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1016-01	Hall by Room 119	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1017-01	Room 119 Computer Lab	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1018-01	Girl's Bathroom by 123 Left	SK	App	3.89	6/3/2021	-	-	-	None	-	-	-
1018-02	Girl's Bathroom by 123 Right	SK	App	1.11	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1019-01	Room 120 Ceramics Counter	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-02	Room 120 Ceramics Unit 1 Left	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-03	Room 120 Ceramics Unit 1 Middle	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-04	Room 120 Ceramics Unit 1 Right	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-05	Room 120 Ceramics Unit 2 Left	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-06	Room 120 Ceramics Unit 2 Middle	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1019-07	Room 120 Ceramics Unit 2 Right	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1020-01	Health Office Bathroom	SK	App	1.02	6/3/2021	-	-	-	None	-	-	-
1020-02	Health Office Soiled Utility Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1020-03	Health Office Clean Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1020-04	Health Office Exam Room 1	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1020-05	Health Office Lab	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1020-06	Health Office Exam Room 2	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1021-01	Room 122	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1022-01	Room 124	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1022-02	Room 124	SPY	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1023-01	Room 126	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1024-01	Room 127	SS	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1025-01	Green House	SP	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1026-01	Hall by Room 129	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1027-01	Room 132 Teacher's Station	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-02	Room 132 Counter @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-03	Room 132 Counter @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-04	Room 132 Fume Hood	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-05	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-06	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-07	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-08	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-09	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-10	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-11	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-12	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-13	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-14	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-15	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-16	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-17	Room 132 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1027-18	Room 132 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1028-01	Room 131 Teacher's Station	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1028-02	Room 131 Counter @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-03	Room 131 Counter @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1029-01	Room 133 Teacher's Station	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1029-02	Room 133 Counter @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1029-03	Room 133 Counter @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1030-01	Room 134 Prep Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-01	Room 136 Teacher's Station	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-02	Room 136 Counter @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-03	Room 136 Counter @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-04	Room 136 Fume Hood	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-05	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-06	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-07	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-08	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-09	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-10	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-11	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-12	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-13	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-14	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-15	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-16	Room 136 Pod 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1031-17	Room 136 Pod 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1032-01	Room 137	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1033-01	Custodial Closet by Room 141	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1034-01	Room 142 Teacher's Station	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1034-02	Room 142 Counter	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1034-03	Room 142A	SK	App		6/3/2021	-	-	-	None	-	-	-
1034-04	Room 142B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1035-01	Hall by Room 153	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1036-01	Faculty Bathroom by Room 159	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1037-01	Women's Faculty Bathroom by Room 159	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1038-01	Boy's Bathroom by Room 159 Left	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1038-02	Boy's Bathroom by Room 159 Right	SK	App	7.72	6/3/2021	-	-	-	None	-	-	-
1039-01	Hall by Room 159	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1040-01	Custodial Closet by Room 159	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1041-01	Girl's Bathroom by Room 159 Left	SK	App	2.25	6/3/2021	-	-	-	None	-	-	-
1041-02	Girl's Bathroom by Room 159 Right	SK	App	5.22	6/3/2021	-	-	-	None	-	-	-
1042-01	Girl's Locker Room Coach's Office	SK	App	2.95	6/3/2021	-	-	-	None	-	-	-
1042-02	Girl's Locker Room Bathroom	SK	App	1.73	6/3/2021	-	-	-	None	-	-	-
1042-03	Girl's Locker Room by Pool Left	SK	App	3.45	6/3/2021	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1042-04	Girl's Locker Room by Pool Right	SK	App	1.7	6/3/2021	-	-	-	None	-	-	-
1043-01	Room 160 Counter 1 A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1043-02	Room 160 Counter 1 B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1043-03	Room 160 Counter 2 A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1043-04	Room 160 Counter 2 B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1043-05	Room 160A Prep Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1044-01	Room 162 Counter 1 A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1044-02	Room 162 Counter 1 B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1044-03	Room 162 Counter 2 A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1044-04	Room 162 Counter 2 B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1044-05	Room 162A Prep Room	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1045-01	Boy's Locker Room Pool Bathroom	WF	App	11.5	6/3/2021	-	-	-	None	-	-	-
1045-02	Boy's Locker Room Pool Bathroom	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1045-03	Boy's Locker Room Coach's Office Bathroom	SK	App	5.22	6/3/2021	-	-	-	None	-	-	-
1045-04	Boy's Locker Room Coach's Office	IM	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1045-05	Boy's Locker Room Bathroom Left	SK	App	1.61	6/3/2021	-	-	-	None	-	-	-
1045-06	Boy's Locker Room Bathroom Right	SK	App	1.25	6/3/2021	-	-	-	None	-	-	-
1045-07	Boy's Locker Room	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1046-01	Girl's Bathroom by Room 178 Left	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1046-02	Girl's Bathroom by Room 178 Middle	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1046-03	Girl's Bathroom by Room 178 Right	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1047-01	Custodial Closet by Room 178	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1048-01	Boy's Bathroom by Room 178 Left	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1048-02	Boy's Bathroom by Room 178 Middle	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1048-03	Boy's Bathroom by Room 178 Right	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1049-01	Hall by Room 178 Left	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1049-02	Hall by Room 178 Right	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1049-03	Hall by Room 178 Right	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1050-01	Hall by Room 177 Left	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1050-02	Hall by Room 177 Right	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1050-03	Hall by Room 177 Right	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1051-01	Prep Room by Room 178	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1052-01	Room 178 Counter 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1052-02	Room 178 Counter 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1052-03	Room 178 Counter 2 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1052-04	Room 178 Counter 2 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1053-01	Room 177 Counter 1 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1053-02	Room 177 Counter 1 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1053-03	Room 177 Counter 2 @ A	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1053-04	Room 177 Counter 2 @ B	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1054-01	Girl's Bathroom by New Cafeteria Left	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1054-02	Girl's Bathroom by New Cafeteria Middle	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1054-03	Girl's Bathroom by New Cafeteria Right	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1055-01	Custodial Closet by New Cafeteria	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1056-01	Boy's Bathroom by New Cafeteria Left	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1056-02	Boy's Bathroom by New Cafeteria Middle	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1056-03	Boy's Bathroom by New Cafeteria Right	SK	N/A		6/3/2021	-	-	-	Mixed Valve Sign Required	-	-	-
1057-01	Hall by New Cafeteria Left	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1057-02	Hall by New Cafeteria Right	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
1057-03	Hall by New Cafeteria Right	BF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1058-01	Left Faculty Bathroom by New Cafeteria	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1059-01	Right Faculty Bathroom by New Cafeteria	SK	N/A		6/3/2021	-	-	-	Sign Required	-	-	-
1060-01	New Cafeteria	SK	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1061-01	Custodial Closet by Auxiliary Gym	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1062-01	Gym	WF	App	<1.0	6/3/2021	-	-	-	None	-	-	-
1063-01	Custodial Closet by Laundry	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
1064-01	PE Office Bathroom by Gym	SK	App	5.35	6/3/2021	-	-	-	None	-	-	-
2001-01	Girl's Bathroom by Room 256 Left	SK	App	3.43	6/3/2021	-	-	-	None	-	-	-
2001-02	Girl's Bathroom by Room 256 Right	SK	App	7.61	6/3/2021	-	-	-	None	-	-	-
2002-01	Hall by Room 256 Left	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2002-02	Hall by Room 256 Right	WF	App		6/3/2021	-	-	-	None	Removed from service	-	-
2003-01	Custodial Closet by Room 256	SS	N/A		6/3/2021	-	-	-	None	Locked Door	-	-
2004-01	Boy's Bathroom by Room 256 Left	SK	App	12.1	6/3/2021	-	-	-	None	-	-	-
2004-02	Boy's Bathroom by Room 256 Right	SK	App	1.82	6/3/2021	-	-	-	None	-	-	-

Laboratory Report

NYE Report #: 2212573-18093

June 7, 2021

Project Manager
Enviroscience Consultants, Inc.
2150 Smithtown Avenue
Ronkonkoma, NY 11779

Project: Westbury High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 03, 2021. New York Environmental analyzed the samples on June 04, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



Li Tsang, Laboratory Director

Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P043	1	Kitchen Ice Machine-IM; Initial	1.00	<1.00	µg/L	
210603P044	2	Kitchen 2-Bay-SK; Initial	1.00	<1.00	µg/L	
210603P045	3	Kitchen 3-Bay Left-SK; Initial	1.00	1.51	µg/L	
210603P046	4	Kitchen 3-Bay Right-SK; Initial	1.00	2.57	µg/L	
210603P047	5	Kitchen Prep in Corner-SK; Initial	1.00	6.14	µg/L	
210603P048	6	Kitchen Prepby Serving Line-SK; Initial	1.00	<1.00	µg/L	
210603P049	7	Kitchen Island-SK; Initial	1.00	<1.00	µg/L	
210603P050	8	Hall by Main Entrance-BF; Initial	1.00	<1.00	µg/L	
210603P051	9	Main Lobby Girl's Bathroom Left-SK; Initial	1.00	19.5	µg/L	H
210603P052	10	Main Lobby Girl's Bathroom Left Middle-SK; Initial	1.00	9.69	µg/L	
210603P053	11	Main Lobby Girl's Bathroom Right Middle-SK; Initial	1.00	6.79	µg/L	
210603P054	12	Main Lobby Girl's Bathroom Right-SK; Initial	1.00	9.93	µg/L	
210603P055	13	Main Lobby Boy's Bathroom Left-SK; Initial	1.00	3.18	µg/L	
210603P056	14	Main Lobby Boy's Bathroom Right-SK; Initial	1.00	2.06	µg/L	
210603P057	15	Principal's Office Bathroom-SK; Initial	1.00	4.12	µg/L	
210603P058	16	Girl's Locker Room Coach's Office-SK; Initial	1.00	2.95	µg/L	
210603P059	17	Girl's Locker Room Bathroom-SK; Initial	1.00	1.73	µg/L	
210603P060	18	Nurse's Office Bathroom-SK; Initial	1.00	6.75	µg/L	
210603P061	19	Nurse's Office-SK; Initial	1.00	7.72	µg/L	
210603P062	20	Faculty Room -BF; Initial	1.00	<1.00	µg/L	
210603P063	21	Faculty Room -WF; Initial	1.00	<1.00	µg/L	
210603P064	22	Faculty Room -SK; Initial	1.00	1.23	µg/L	
210603P065	23	Girl's Bathroom by Suite 112 Social Worker-SK; Initial	1.00	1.39	µg/L	
210603P066	24	Boy's Bathroom by Suite 112 Social Worker-SK; Initial	1.00	2.63	µg/L	
210603P067	25	Band Room-SK; Initial	1.00	10.8	µg/L	
210603P068	26	Band Room Office-SK; Initial	1.00	7.99	µg/L	



Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P069	27	Boy's Bathroom by Room 119 Left-SK; Initial	1.00	<1.00	µg/L	
210603P070	28	Boy's Bathroom by Room 119 Right-SK; Initial	1.00	1.74	µg/L	
210603P071	29	Girl's Bathroom by 123 Left-SK; Initial	1.00	3.89	µg/L	
210603P072	30	Girl's Bathroom by 123 Right-SK; Initial	1.00	1.11	µg/L	
210603P073	31	Health Office Bathroom-SK; Initial	1.00	1.02	µg/L	
210603P074	32	Health Office Exam Room 1-SK; Initial	1.00	<1.00	µg/L	
210603P075	33	Health Office Exam Room 2-SK; Initial	1.00	<1.00	µg/L	
210603P076	34	Boy's Bathroom by Room 159 Right-SK; Initial	1.00	7.72	µg/L	
210603P077	35	Girl's Bathroom by Room 159 Right-SK; Initial	1.00	2.25	µg/L	
210603P078	36	Girl's Bathroom by Room 159 Left-SK; Initial	1.00	5.22	µg/L	
210603P079	37	Girl's Locker Room by Pool Left-SK; Initial	1.00	3.45	µg/L	
210603P080	38	Girl's Locker Room by Pool Right-SK; Initial	1.00	1.70	µg/L	
210603P081	39	Boy's Locker Room Pool Bathroom-WF; Initial	1.00	11.5	µg/L	
210603P082	40	Boy's Locker Room Pool Bathroom-SK; Initial	1.00	<1.00	µg/L	
210603P083	41	Girl's Bathroom by Room 256 Left-SK; Initial	1.00	3.43	µg/L	
210603P084	42	Girl's Bathroom by Room 256 Right-SK; Initial	1.00	7.61	µg/L	
210603P085	43	Hall by Room 256 Left-WF; Initial	1.00	5.09	µg/L	
210603P086	44	Hall by Room 256 Right-WF; Initial	1.00	10.4	µg/L	
210603P087	45	Boy's Bathroom by Room 256 Left-SK; Initial	1.00	12.1	µg/L	
210603P088	46	Boy's Bathroom by Room 256 Right-SK; Initial	1.00	1.82	µg/L	
210603P089	47	Hall by Room 178 Right-BF; Initial	1.00	<1.00	µg/L	
210603P090	48	Hall by Room 177 Right-BF; Initial	1.00	<1.00	µg/L	
210603P091	49	Hall by New Cafeteria Right-BF; Initial	1.00	<1.00	µg/L	
210603P092	50	New Cafeteria-SK; Initial	1.00	<1.00	µg/L	
210603P093	51	Gym-WF; Initial	1.00	<1.00	µg/L	
210603P094	52	PE Office Bathroom by Gym-SK; Initial	1.00	5.35	µg/L	
210603P095	53	Boy's Locker Room Coach's Office Bathroom-SK; Initial	1.00	5.22	µg/L	



Date Collected:	03 Jun 2021
Date Received:	03 Jun 2021
Date Analyzed:	04 Jun 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
210603P096	54	Boy's Locker Room Coach's Office-IM; Initial	1.00	<1.00	µg/L	
210603P097	55	Boy's Locker Room Bathroom Left-SK; Initial	1.00	1.61	µg/L	
210603P098	56	Boy's Locker Room Bathroom Right-SK; Initial	1.00	1.25	µg/L	
210603P099	57	Custodial Office Bathroom-SK; Initial	1.00	13.3	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.